# Comparison of Ageing Deterioration of Silicone Rubber Housing Material for Outdoor Polymer Insulators

S.Thong-Om, W. Payakcho, J. Grasasom, A. Oonsivilaiand B. Marungsri

**Abstract**—This paper presents the comparison ageing deterioration of silicone rubber housing material for outdoor polymer insulators by using salt fog ageing test based on IEC 61109 and outdoor exposure test. Four types of high temperature silicone vulcanized silicone rubber sheet with different amount of ATH were used as testing specimen. For salt fog ageing test, the specimens were tested continuously 1000 hours with energized in test chamber. For outdoor exposure test, the specimens were hung continuously 18 months without energized. Physical and chemical analyses were conducted to evaluate degree of ageing deterioration of tested specimens. Slightly surface erosion was observed on specimen surface after salt fog ageing test and no erosion was observed on surface of outdoor exposure specimen. However, comparable degree of ageing deterioration can be seen from surface analysis results.

*Keywords*—Accelerated ageing test, outdoor exposure test, HTV silicone rubber, housing material, salt fog test, surface erosion, polymer insulator

# I. INTRODUCTION

 $\mathbf{S}$  ILICONE rubbers using in the area of high voltage insulation are mainly based on polydimethylsiloxane (PDMS). PDMS is the synthesis polymer commonly used in silicone rubber formulations for high voltage outdoor insulation applications. PDMS consists of an inorganic backbone of alternating silicon and oxygen atoms [1]. Methyl groups are attached to the silicon atoms forming the repeating unit in the polymer. The structural characteristics of PDMS are important for its properties. The hydrophobic character of PDMS is due to the close packing of the methyl groups, which under normal conditions point outward from the surface and provides the polymer with a hydrophobic skin. The molecular structure of siloxane chain is helical structure. Six Si-O bonds are included in one turn of the helix. Thus, the surface of silicone polymer is covered by a nearly hydrophobic methyl group, and the surface energy is low. Four structural characteristics of PDMS account for its surface properties: (1) the low intermolecular force between methyl groups, (2) the unique flexibility of the siloxane bond, (3) the high strength of the siloxane bonds and (4) the partial ionic nature of the siloxane bond.

These characteristics give PDMS a number of properties that make the material suitable for the production of high voltage outdoor polymer insulators[2].

- (a) Good dielectric properties.
- (b) Excellent resistance to weathering.
- (c) Hydrophobic surface properties.
- (d) High thermal and oxidative stability.

Silicone rubber compounds retain hydrophobicity better than ceramic or glass, especially in coastal regions and contaminated areas. Polymer insulators are lightweight, and they can significantly reduce losses from breakage and vandalism.Furthermore, additives and fillers(Alumina trihydrate(ATH):Al<sub>2</sub>O<sub>3</sub>·3H<sub>2</sub>O) are included inthe silicone rubber for improve the long-term performance under environment stresses [1-5].

When a polymer insulator is employed and used in service for a long period and exposed under high voltage to weather, pollution and other environmental stresses, changes in the characteristics of the polymer insulator cannot be avoided because it is made of organic materials. Polymers unlike ceramic and glass, are organic materials that can degrade under variety of stresses, so ageing deterioration is not avoidable [6].These long-term change in characteristics are generally classified as ageing.

The most concern in long-term performance of polymer insulators is the surface deterioration of housing material, which may reduce its ability to prevent water ingress to the FRP core. Loss of surface hydrophobicity on silicone rubber leads to surface deterioration. The loss of hydrophobicity during outdoor application by electrical and environmental stresses gradually enhances surface wetting and forms contaminated water films having high conductivity. This induces leakage current on the polymer insulator surface. Niemi and Orbeck [7] suggested that failure of polymer insulators is initiated by large leakage currents and dryband arcing. Gorur et al. [8] who also suggested that ageing deterioration of silicone rubber housing materials in outdoor high voltage insulation applications started with the loss of hydrophobicity due to the dry band arcing. Many researchers tried to investigate the correlation among leakage current, discharge activity, surface wetting and ageing deterioration of housing material[9-22]. Furthermore, effects of UV radiation [23,24], thermal [18,25], acids [26-28], corona discharges[17, 29-31] on ageing of housing material are investigated worldwide.

It is necessary to elucidate the ageing behavior of outdoor polymer insulators when they are applied to actual power systems. Salt fog ageing tests are widely conducted to evaluate the anti-tracking/anti-erosion performances of housing materials for outdoor polymer insulators. The deterioration of their surfaces in the salt fog ageing test depended on many effect such as filler content and their

S.Thongom, W. Payakcho and J. Grasasomare master degree student with Suranaree University of Technology, Nakhon Ratchasima, 30000, Thailand.

A.Oonsivilai is with Center of Excellence in Electric Energy, Smart Materials, and Health Science, Postharvest Technology Research Center, School of Electrical Engineering, Suranaree University of Technology, Nakhon Ratchasima 30000 Thailand.

<sup>\*</sup>B. Marungsri are with Suranaree University of Technology, Nakhon Ratchasima, 30000, Thailand (corresponding author, phone: +66 44224366; fax:+66 4422 4601; e-mail: bmshvee@ sut.ac.th).

configuration [32]. Furthermore, surface tracking and weather shed puncture occurred on the polymer insulator surface resulting from many effect such as surface wetting, degree of contamination and dry-band arcing [33,34].

The 1000 hours duration salt fog ageing test is extensively applied. In this test, specimens are continuously under salt fog at constant voltage. The test is evaluating anti-tracking and/or anti-erosion performance of housing materials for polymer insulators. Outdoor exposuretest, specimens are hungvertically of the stainless steel. The test is subjected to a variety of environmental (e.g. thermal, UV-radiation, rain, winds etc.) area Suranaree University of Technology, located NakhonRatchasima, THAILAND.

This paper presents salt fog ageing test results was conducted based on IEC 61109 specifications andoutdoor exposuretest results of silicone rubber [35].

### II. EXPERIMENTAL


# A. Specimens

Rubber sheets made of high-temperature vulcanized silicone rubber (HTV SiR) with/without alumina trihydrate (ATH:  $Al_2O_3 \cdot 3H_2O$ ) having content 0%, 50%, 100% and 150% by weight were used as specimens in this experimental. Specimens were classified into 4 types according to ATH content, as shown in Table I and Fig. 1.

For salt fog ageing test, specimens having 2 mm in thickness, 30 mm in width and 200 mm in length attached with metal electrodes on the both ends were used while specimens having 200 mm in length were used for outdoor exposure test. Configuration of tested specimen illustrated in Fig. 2(a) and 2(b).

TABLE I	
CHARACTERISTICS OF HTV SPECIMENS	

Туре	With surface treatment	ATH (wt %)
А	$\checkmark$	0
В	$\checkmark$	50
С	$\checkmark$	100
D	$\checkmark$	150

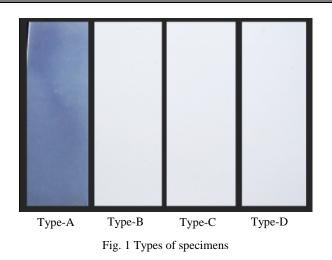

#### B. Test Arrangement and Test Methods

In this study, ageing deterioration of tested specimens using salt fog ageing test was considered comparing with specimens from outdoor exposure. A polyethylene tank having the volume  $4.0 \text{ m}^3$  was used as the salt fog test chamber. During salt fog ageing test, specimens were hung vertically in the test chamber. An ultrasonic humidifier was used as salt fog generating source and salt fog was injected from the top of the test chamber. Test arrangement is illustrated in Fig. 3 and actual test chamber is illustrated in Fig 4.

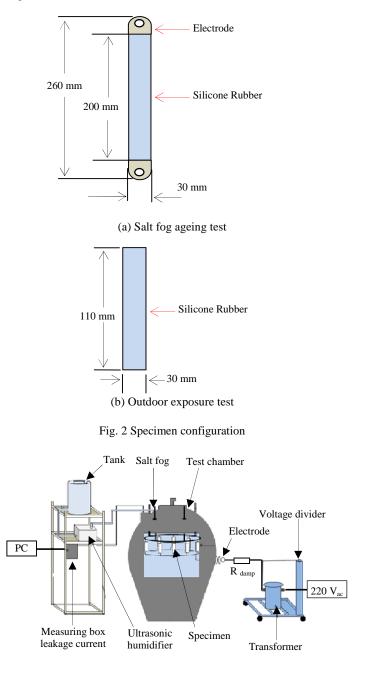


Fig. 3 Test arrangement

All specimens were hung vertically in open environments for outdoor exposure test, as shown in Fig. 5. Only, effect of environmental, i.e. UV, rain, dust, etc., was considered. All specimens were hung in parallel with the north and the south.For every day, specimen surface was exposed to morning and afternoon sunlight.Ageing deterioration of Tank Measuring cable Test chamber Voltage divider Electrode Measuring Box forleakage current Ultrasonic humidifier Transformer

specimen surface due to morning and afternoon sunlight is

Fig. 4 Salt Fog Test chamber

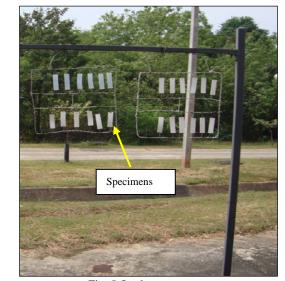


Fig. 5 Outdoor exposuretest

# C. Test Conditions

Specimens were subjected to a constant voltage based on IEC 61109 for salt fog ageing test. Test conditions illustrated in Table II. The cyclic salt fog ageing test was conducted by injecting salt fog in to the test chamber for 8 hours and stopping it for 16 hours every day under ac high voltage 15 kV. The salt fog having injection rate 0.5 l/hr/m<sup>3</sup> was injected from the top of the chamber.All specimens were hung vertically in test chamber and were tested together.

TABLE IITEST CONDITIONS [36]

Salt fog ageing test	Conditions			
test chamber	4 m <sup>3</sup>			
test voltage	AC15 kV Continuously Applied			
voltage stress	75 V/mm			
salt fog generation	Ultrasonic Humidifier			
salt fog injection rate	$0.5 \ l/hr/m^3$			
salt fog salinity	$10 \text{ kg/m}^3$ (16000 µS/cm)			
test sequence in 24 hours	Salt fog injected for 8 hoursand stopped			
-	for 16 hours			


In case of outdoor exposure test, 4 type specimens were hung continuously without energized.Both sides of specimen surface were analyzed degree of ageing deterioration every three months.

#### III. TEST RESULTS AND DISCUSSION

For evaluation ageing deterioration degree, many physical and chemical analyses were conducted. Firstly, visual observation by naked eyes was conducted to observe any discernible change of specimen surface. Also, hydrophobicity, contamination degree and hardness measurements were conducted. Thesetechniques were defined as physical analysis. Fourier transform infrared ray spectroscopic (FTIR) analysis is a surface chemical analysis technique that provides information about the chemical bonding or molecular structure of materials. In this study, any chemical changes on specimen surface were analyzed by ATR-FITR.

## A. Visual Observation

During salt fog ageing test, many electrical discharge activities were occurred. Such electrical discharge may lead to surface deterioration. After 1000 hours salt fog ageing test, visual observation was conducted in order to inspect any change on tested specimen surface. Any severe surface damage was not observed on all tested specimen surface.But dirtwere contaminant and observed on specimen surface.However, slight surface erosion close to the energized end portion was observed on type A and type B tested specimens. This occurrence may be caused by discharges on specimens'surface during test due to higher electric field stress on such position. Under the same test conditions, no surface erosion was observed on specimen type C and type D. The results confirm that the amount of ATH is effective to improve the anti-erosion performance of siliconerubber.

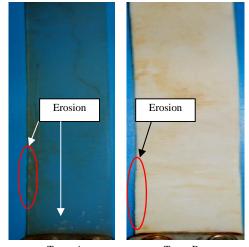

Type- A Type- B Fig. 6 Specimens surface after 1000h of salt fog ageing test

After 18 months of outdoor exposure, any visible damage of specimen surface was not observed. Only, dust particles were observed on the both sides of specimen surface as shown in Fig.7.

aim.

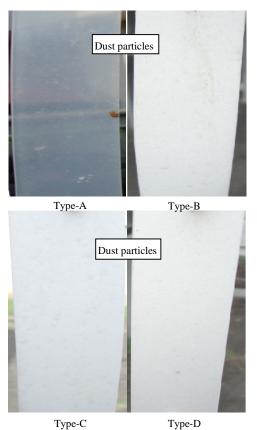


Fig. 7 Specimens surface after 18 months of outdoor exposure

# B. Hydrophobicity

Surface discharges, i.e. dry band arc and corona discharges, accompanying the contaminant deposit on the specimen surface led to a reduction in hydrophobicity. Reduction of silicone rubber surface hydrophobicity by electrical and environmental stresses could accelerate the surface deterioration. The occurrence of surface deterioration and contaminant deposition on the specimen surface may be related to the reduction in hydrophobicity. This induces leakage current and dry band arc discharges on the polymer insulator surface. Uncontrolled leakage current promotes intense dry band arcing or surface discharges, can ultimately lead to material degradation and may be tothe reduction in hydrophobicity[37,38].Reduction in hydrophobicity was evaluated by STRI criteria [39], as shown in Fig.8.Thecharacteristics of hydrophobicity on tested specimen surface are shown in Fig.9(a) for salt fog ageing test, and as

shownin Fig.9(b) for outdoor exposure test. Hydrophobicity measurement results are shown in Table III.

Significant decreasing in hydrophobicity can be observed on thoroughly surface of the salt fog ageing test specimens.Extremely loss of hydrophobicity (HC 6) was observed on thoroughly surface of specimen type A. In the case of the specimen without ATH and with surface treatment, a larger reduction in hydrophobicity can be seen compared with the other specimens having ATH. Such results indicate that ATH filler and surface treatment can delay the reduction of hydrophobicity on silicone rubber surface.

Also, extremely loss of hydrophobicity (HC 6) at energized end was observed on all specimen surfaces.

Such results indicate that high electric field stress can accelerate the reduction of hydrophobicity on the specimen surface.

After 18 months of outdoor exposure, all specimens remain their good property of hydrophobicity surface, as shown in Fig. 9 (b). Any discernible difference in reduction of hydrophobicity on specimen surface exposure to morning and afternoon sunlight was not observed. This result shows that mild environment and sunlight without energized in short time exposure may not affect to loss of hydrophobicity. By using STRI hydrophobic classification guide, all specimen surface remained high level of hydrophobicity (HC:1-2) on both sides, exposure to morning and afternoon sunlight.

TABLE III REDUCTION OF HYDROPHOBICITY

Position		Specimen				
POSI	uon	Type-A	Type-B	Type-C	Type-D	
Groun	d end	HC6	HC4	HC4	HC4	
Mic	ldle	HC6	HC4	HC4	HC5	
Energiz	zed end	HC6	HC6	HC6	HC6	
	6*	HC1	HC1	HC1	HC1	
	9*	HC1	HC1	HC1	HC1	
MT	12*	HC1	HC1	HC1	HC1	
	15*	HC2	HC1	HC1	HC1	
	18*	HC2	HC1	HC1	HC1	
	6*	HC1	HC1	HC1	HC1	
	9*	HC1	HC1	HC1	HC1	
AT	12*	HC1	HC1	HC1	HC1	
	15*	HC2	HC1	HC1	HC1	
	18*	HC2	HC1	HC1	HC1	

New specimens: HC1, \* Months



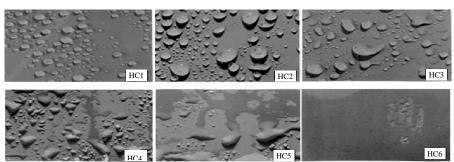



Fig. 8 Characteristics of the sample surfaceHC1-HC6

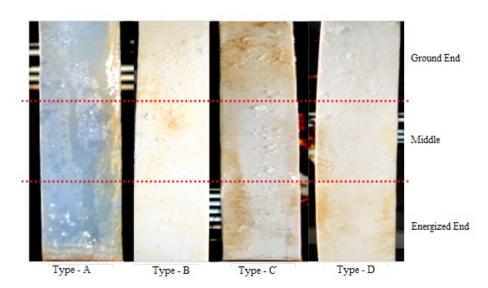

(a) After 1000 hours salt fog ageing test

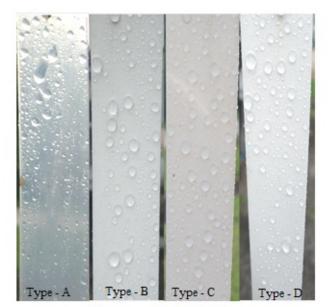

Exposure to Morning Sunlight

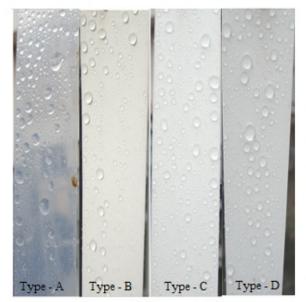

Exposure to Afternoon Sunlight

Vol:5, No:12, 2011

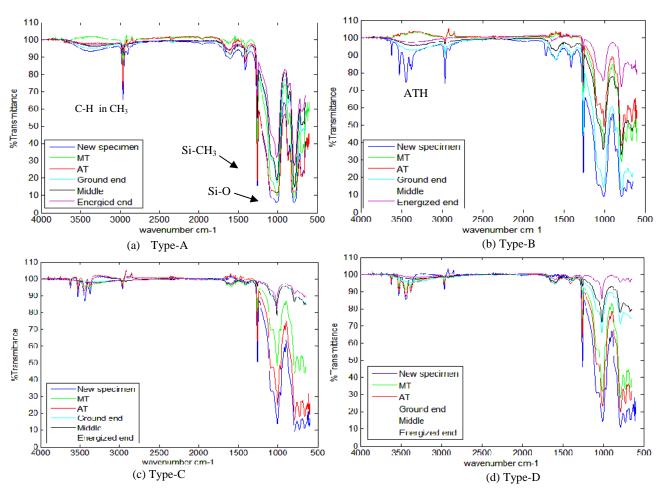


Fig. 10 FTIR spectra of test specimens (MT and AT of 18 months)

			% Transmittance							
T71 .*		Type-A		Туре-В		Туре-С		Type-D	)	
	V1	Vibration		Si-CH <sub>3</sub>	Si-O	Si-CH <sub>3</sub>	Si-O	Si-CH <sub>3</sub>	Si-O	Si-CH <sub>3</sub>
	N	ew	100	100	100	100	100	100	100	100
	Grou	nd end	78.36	55.4	90.25	70.97	85.43	99.83	36.46	19.29
	Mi	ddle	53.23	76.37	63.02	25.42	64.71	57.17	35.01	20.17
	Energiz	zed end	63.34	38.81	47.10	21.67	22.42	24.48	26.72	14.42
	MT	6*	84.37	68.63	65.00	45.50	79.58	68.06	31.23	23.46
		9*	51.76	36.43	51.01	33.68	10.43	6.14	2.05	4.09
		12*	9.88	6.94	25.55	17.61	19.82	16.28	15.55	11.57
		15*	83.51	82.58	88.93	95.18	90.89	94.48	66.39	48.52
		18*	91.38	78.19	58.43	40.68	68.29	54.91	49.73	41.76
	AT	6*	90.81	73.44	65.47	45.17	68.30	54.91	35.43	25.42
		9*	72.05	51.9	18.78	12.78	15.03	8.48	7.29	4.97
		12*	49.49	33.49	70.61	50.98	94.66	88.15	21.65	20.53
		15*	83.06	83.00	93.94	69.11	95.42	98.03	83.29	76.71
		18*	95.21	97.19	47.41	35.62	79.58	68.06	80.25	74.65

Specimen Position Type-A Type-B Type-C Type-D New 66 76.64 82.88 89.36 67.04 77.6 90.96 Ground end 84.64 Middle 65.68 77.28 84.24 89.76 Energized end 67.2 76.64 82.88 89.36 6\* 66.16 75.92 83.12 88.64 **0**\* 69.12 79.52 92.4 86 68.96 80.24 86.72 MT 12\* 92.8 68.16 80.48 87.2 93.52 15\* 18\* 68.8 80.8 87.36 93.68 6\* 66.23 76.56 83.68 90.48 9\* 69.2 78.16 86.08 92.4 93.36 AT 12\* 68.48 80.4 86.8 68.64 80.32 87.2 93.52 15\* 18\* 69.04 80.96 86.32 93.76

TABLE V HARDNESS OF THE SPECIMEN BY SHORE A SCALE

# IV. CONCLUSION

Comparisons of ageing deterioration of silicone rubber housing material for outdoor polymer insulator based on IEC 61109 (salt fog ageing test 1000 hrs.) and outdoor exposure test were conducted. The following conclusions were given.

- 1.) Electrical stress, electric discharges and pollutants deposited on the surface of specimens caused ageing deterioration of specimens' surface.
- 2.) For salt fog ageing test, slightly erosion was observed on the specimens type-A (ATH 0 pph) and Type-B (ATH 50 pph). Onlydust particleswere observed on surface ofoutdoor exposure specimens.
- 3.) For salt fog ageing test, extremelyreduction of hydrophobicity (HC6) was observed on the 4 type's specimens near the energized end.Foroutdoor exposure test, specimens retained high hydrophobicity (HC:1-2) of sidesboth (MT and AT).
- 4.) The chemical analysis by ATR FTIR also confirmed surface deterioration of silicone rubber housing material for polymer insulator in these tests.
- 5.) For outdoor exposure test, slightly increasing in hardness was measured for all specimen surfaces compared with salt fog ageing test specimens.

## ACKNOWLEDGMENT

The Author would like to thank you Suranaree University of Technology and National Research Council of Thailand for kind financial support.

#### REFERENCES

- Y. Ono, "Silicone-Fields of Application and Technological Trends", [1] Shin-Etsu Chemical Co. Ltd., Japan, 2003.
- R. S. Gorur, E. A. Cherney and R. Hackam, "A Comparative Study of [2] Polymer Insulating Materials under Salt Fog Test", IEEE Trans.onElectrical Insulation, Vol. EI - 21, No. 2, April 1986, pp. 175 -182
- [3] CIGRE TF33.04.07, "Natural and Artificial Ageing and Pollution Testing of Polymer Insulators", CIGRE Pub. 142, June 1999
- T. Zhao and R. A. Bernstorf, "Ageing Tests of Polymeric Housing [4] Materials for Non - ceramic Insulators", IEEE Electrical Insulation Magazine, Vol. 14, No. 2, March/April 1998, pp. 26 - 33.
- [5] M. C. Marklove and J. C. G. Wheeler, "Salt - Fog Testing of Composite Insulators", 7th Int. Conf. on Dielctric Material, Measurements and Applications, Conf. Pub. No. 430, September 1996, pp. 299 - 302.
- S. Thong-om, W. Payakcho, J. Grasasom and B. Marungsri, [6] "Comparison of Ageing Deterioration of Silicone Rubber Housing Material for Outdoor Polymer Insulators", World Academy of Science, Engineering and Technology 80, 2011, pp. 533-539.
- R. G. Neimi and T. Orbeck, "Test Methods Useful in Determining the [7] Wet Voltage Capability of Polymer Insulator Systems after Time Related Outdoor Exposure", IEEE Trans. on EI, Vol. E I-9, No. 3, September 1974.
- R.S. Gorur, G. G. Karady, A. Jagota, M. Shah and A. M. Yates, " [8] Ageing in Silicone Rubber Used for Outdoor Insulations", IEEE Trans.on Power Deliv., Vol. 7., No. 2, pp. 525-538, April 1992.
- [9] S. H. Kim, E. A. Cherney and R. Hackam, "The Loss and Recovery of Hydrophobicity of RTV Silicone Rubber Coatings", IEEE Trans.on. Power Deliv., Vol. 5, No. 3, pp. 1491-1499, 1990.
- [10] R. S. Gorur, J. W. Chang and O. G. Amburgey, "Surface Hydrophobicity of Polymers Used for Outdoor Insulation", IEEE Trans.on Power Deliv., Vol. 5, No. 4, pp. 1923-1928, 1990.
- [11] S. H. Kim, E. A. Cherney and R. Hackam, "Hydrophobic Behavior of Insulators Coated with RTV Silicone Rubber", IEEE Trans.on EI, Vol. 27, No. 3, pp. 610-622, 1992.
- [12] S. H. Kim, E. A. Cherney and R. Hackam, "Effects of Filler Level in RTV Silicone Rubber Coatings Used in HV Insulators", IEEE Trans.on EI, Vol. 27, No. 6, pp. 1065-1072, 1992. [13] S. M. Gubanski, "Properties of Silicone Rubber Housings and
- Coatings", IEEE Trans.on EI, Vol. 27, No. 2, pp. 374-382, 1992.
- [14] H. Homma, T. Takahashi, T. Taniguchi and K. Izumi, "Study on Surface Degradation of Polymer Insulating Materials Caused by Leakage Current", Annual Report of 1994 CEIDP, pp. 373-378, 1994.
- [15] S. Kim, E. A. Cherney, R. Hackam and K. G. Rutherford, "Chemical Changes at the Surface of RTV Silicone Rubber Coating on Insulators during Dry-band Arcing", IEEE Trans.on DEI, Vol. 1, No. 1, pp. 106-123, 1994.
- [16] H. Homma, T. Kuroyagi, K. Izumi, J. Ronzello and S. A. Boggs, "Evaluation on Surface Degradation of Polymer Insulating Materials Using GC/MS", Proceedings of 5 th ICSD, pp. 575-579, 1995.
- [17] S. Kumagai and N. Yoshimura, "Hydrophobicity Recovery of Silicone Rubber and LMW Behavior", Proceedings of 1998 ISEIM, pp. 457-460, 1998.
- [18] N. Yoshimura, S. Kumagai and S. Nishimura, "Electrical and Environmental Silicone Rubbers Used in Outdoor Insulation", IEEE Trans.on DEI, Vol. 6, No. 5, pp. 632-650, 1999.
- [19] H. Homma, T. Kuroyagi, K. Izumi, C. L. Mirley, J. Ronzello and S. A. Boggs, "Diffusion of Low Molecular Weight Siloxane from Bulk to Surface", IEEE Trans.on DEI, Vol. 6, No. 3, pp. 370-375, 1999.
- [20] J. Kim, M. K. Chaudhury and M. J. Owen, "Hydrophobicity Loss and Recovery of Silicone HV Insulation", IEEE Trans.on DEI, Vol. 6, No. 5, pp. 695-702, 1999.
- [21] J. P. Reynders, I. R. Jandrell and S. M. Reynders, "Review of Aging and Recovery of Silicone Rubber Insulation for Outdoor Use", IEEE Trans.on DEI, Vol. 6, No. 5, pp. 620-631, 1999.
- [22] H. Hillborg and U. W. Gedde, "Hydrophobicity Changes in Silicone Rubbers", IEEE Trans.on DEI, Vol. 6, No. 5, pp. 703-717, 1999.
- [23] R. S. Gorur, D. W. Gerlach and R. S. Thallam, "Aging in Outdoor Insulating Polymers due to UV and High Temperature", Annual Report of 1991 CEIDP, pp. 268-273, 1991.
- [24] T. Imakoma, Y. Suzuki, O. Fujii and I. Nakajima, "Degradation of Silicone Rubber Housing by Ultraviolet Radiation", Proceedings of 4th ICPADM, pp. 306-308, 1994.

- [25] T. Berger, S. Sundhararajan and T. Nagaosa, "Influence of Temperature on the Hydrophobicity of Polymers", Annual Report of 1997 CEIDP, pp. 394-397, 1997.
- [26] J. Y. Koo, I. T. Kim, J. T. Kim and W. K. Park, "An Experimental Investigation on the Degradation Characteristic of the Outdoor Silicone Insulator due to Sulfate and Nitrate Ions", Annual Report of 1997 CEIDP, pp. 370-373, 1997.
- [27] J. Y. Koo, I. T. Kim, J. T. Kim and W. K. Park, "A Possible Aging Mechanism Related to the Outdoor Silicone Rubber Insulator due to the Sulfuric and Nitric Solution", CIGRE, Paper 15-203, 1998.
- [28] X. Wang, S. Kumagai and N. Yoshimura, "Performance of Silicone Rubber Insulator Subjected to Acid Rain Contaminant", IEEE Trans.on DEI, Vol. 5, No. 6, pp. 909-916, 1998.
- [29] E. A. Cherney, "Non-Ceramic Insulators -A Simple Design that Requires Careful Analysis", IEEE Elect.Insu.Magazine, Vol. 12, No. 3, pp. 7-15, 1996.
- [30] Y. Koshino, I. Umeda and M. Ishiwari, "Deterioration of Silicone Rubber for Polymer Insulators by Corona Discharge and Effect of Fillers", Trans. IEE of Japan, Vol. 118-A, No. 6, pp. 683-688, 1998. (in Japanese)
- [31] A. J. Philips, D. J. Childs and H. M. Schneider, "Water Drop Corona Effects on Full-scale 500 kV Non-ceramic Insulators", IEEE Trans. on Power Deliv., Vol. 14, No. 1, pp. 258-263, 1999.
- [32] M.G. Danikas, "Polymer Outdoor Insulators", ACTA Electrotehnica Napocensis, Vol. 40, No. 1, 1999.
- [33] B. Marungsri, H. Shinokubo, R. Matsuoka and S. Kumagai, "Effect of Specimen Configuration on Deterioration of Silicone Rubber for Polymer Insulators in Salt Fog Ageing Test", IEEE Trans. on DEI, Vol.13, No. 1, February 2006, pp. 129 – 138.
- [34] L.S. Nasrat and A. Nosseir, "Evaluation of polymeric insulating materials under polluted conditions", CIGRE 2002, 15-402.
- [35] T. Zhao and S. John, "Salt Fog Ageing Tests on Non –Ceramic Insulators and Fog Chamber Data Acquisition System", IEEE Conf. Electrical Insulation and Dielectric Phenomena, 1996. pp. 377-380.
- [36] I. Gutman, R. Harting, R. Matsuoka and K. Kondo, "Experience with IEC 1109 1000h Salt Fog Ageing Test for Composite Insulators", IEEE Electrical Insulation Magazine, Vol. 13, No. 3, May/June, 1997, pp. 36 – 39.
- [37] T. Zhao and R.A. Bernstorf, "Ageing Tests on of Polymeric Housing Materials for Non –Ceramic Insulators", IEEE Electrical Insulation Magazine, Vol. 14, No. 2, March/April, 1998, pp. 26 – 33.
- [38] J. W. Chang and R. S. Gorur, "Surface Recovery of Silicone Rubber Used for HV Outdoor Insulation", IEEE Trans. on DEI, Vol.1, No. 6, December1994, pp. 1093 – 1046.
- [39] STRI Guide,"Hydrophobicity Classification Guide", 92/1, 1992.
- [40] H. Liu, G. Cash, D. Birtwhistle and G. George, "Characterization of a Severely Degraded Silicone Elastomer HV Insulator-an Aid to Development of lifetime Assessment Techniques", IEEE Trans. on DEI, Vol.12, No. 3, June 2006, pp. 478 – 486.
- [41] ISO 868, "Plastics and ebonite Determination of indentation hardness by means of a durometer (Shore hardness)".



Suchart Thong-Om was born in Surin province, northeastern of THAILAND, in 1987. He received B. Eng. in Electrical Engineering from Suranaree University of Technology, Nakhon Ratchsima, in 2009. Currently, He is a master degree student in school of Electrical Engineering, Suranaree University of Technology. His research topic interesting is High voltage insulation technology.



Worawit Payakcho was born in Phra Nakhon Si Ayutthaya, Thailand, in 1986. He received his B.Eng. in Electrical Engineering from Suranaree University of Technology, NakhonRatchasima, Thailand, in 2007. He is currently a master degree student in school of Electrical Engineering, institute of Engineering at same the University. His interesting areas High voltage Technology applications, High Voltage Insulation Technology and Power System Technology.



Janejira Grasaesom was born in Nakhon Ratchasima Province, Thailand, in 1986. She received B.Eng. in Electrical Engineering from Suranaree University of Technology, Nakhon Ratchasima, Thailand, in 2007. She is currently a master degree student in School of Electrical Engineering, Institute of Engineering at same the University. Her research topics interestingare high voltage technology application, high voltage insulation technology and power system technology.



Anant Oonsivilai,was born in KhonKaen Province, Thailand, in 1963. He received his B.Eng from Khon KhanUniversity, and M.Eng. from King Mongkut Institute of Technology North Bangkok, Thailand and PhD. From Dalhousie University, Canada, all in Electrical Engineering, in 1986,1992 and 2000, respectively. Dr. Oonsivilai is currently an Assistanst Professor in school of Electrical Engineering, Suranaree University of Technology, Thailand.



**Boonruang Marungsri**was born in Nakhon Ratchasima Province, Thailand, in 1973. He received his B. Eng. and M. Eng. from Chulalongkorn University, Thailand in 1996 and 1999 and D. Eng. from Chubu University, Kasugai, Aichi, Japan in 2006, all in electrical engineering, respectively. Dr. Marungsri is currently an assistant professor in School of Electrical Engineering, Suranaree University of Technology, Thailand. His areas of interest are high voltage insulation technologies and electrical power system.